

Date: Thursday, 10/26/2006 8:24:23 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 206 A/B HIGH GEAR SKIDTUBE
 Job Number : 29179
 Estimate Number : 10161
 P.O. Number : N/A Part Number : D206642211
 This Issue : 10/26/2006 S.O. No. : N/A Drawing Number : N/A
 Prsht Rev. : NC Project Number : N/A
 First Issue : N/A Type : LANDING GEAR Drawing Revision : N/A
 Previous Run : 29178 Material : N/A
 Due Date : 11/27/2006 Qty: 1 Um: Each
 Written By :
 Checked & Approved By :
 Comment : Est Rev:J 04.08.06 Revised Step 4 per CHG003 KJ/JLM J 0
 4.08.06

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP206-642-211 CHG004

KS 07.02.20

HARRIS

2.0 29179A HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B



Comment: Sub-Component HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
 D206-642-241 B 29179A

3.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1
 Pick Packing Kit

4.0 D206651041 206 A/B GHW Kit



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

1 D206-651-041 GHW Kit

B28638 ✓

B27963 07/3/14

5.0 D2652 Bushing



Comment: Qty.: 16.0000 Each(s)/Unit Total: 16.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

16 D2652

Bushings

B29007 (11x) ✓

B29227 (5x) ✓

07/3/14

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:24:23 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 29179

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

D2655

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

1 D2655 Tow Ring B28958 ✓

7.0

D26651

Saddle, LH Fwd Aft Out



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2665-1 Saddle B28601 ✓

8.0

D26661

Saddle, LH, Fwd, Aft, In



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2666-1 Saddle B28405 ✓

9.0

D2712

Set Screw



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

10 D2712 Set Screw B26481 ✓

10.0

D2884

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

SADDLE SPACER

Batch: B28259 ✓

11.0

D2885

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Saddle Spacer

B27969 ✓

Bo7/03/14 ✓

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:24:23 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 29179

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

AN341A

Bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN3-41A

Bolt

M101938 ✓

M102472 ✓

13.0

AN45A

Bolt



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 AN4-5A

Bolt

M100857 ✓

14.0

AN46A

Bolt



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

12 AN4-6A

Bolt

M102959 ✓

15.0

AN57A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-7A

Bolt

M102140 ✓

16.0

AN511A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-11A

Bolt

M102658 ✓

17.0

AN644A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 AN6-44A

Bolt

M102079 ✓

04/13/140

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:24:24 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 29179

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

AN960JD10

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN960JD10

Washer

1103492 ✓

19.0

AN960JD416

Washer



Comment: Qty.: 25.0000 Each(s)/Unit Total : 25.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

25 AN960JD416

Washer

1103338 ✓

20.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN960JD516

Washer

1102519 ✓

21.0

AN960JD616

Washer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN960JD616

Washer

1102829 ✓

22.0

MS21042L3

Nut



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 MS21042L3

Nut (or -3)

1102658 ✓

CP 4/03/140

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: AP Date: 07/03/15
 QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:24:24 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 29179

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

23.0

MS21042L4

Nut



Comment: Qty.: 12.0000 Each(s)/Unit Total: 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

12 MS21042L4

Nut (or -4)

M1033419

24.0

MS21042L6

Nut



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 MS21042L6

Nut (or -6)

M100151

25.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

26.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-211

Location:

REV D

27.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



U 07-03-15

Dart Aerospace Ltd

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:25:13 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
 Job Number : 29179A
 Estimate Number : 10163
 P.O. Number : N/A Part Number : D206642241
 This Issue : 10/26/2006 S.O. No. : N/A Drawing Number : D2650 REV E P1,3
 Prsht Rev. : NC Project Number : N/A
 First Issue : N/A Type : LANDING GEAR Drawing Revision : E
 Previous Run : 29178A Material : N/A
 Due Date : 11/27/2006 Qty: 1 Um: Each
 Written By :
 Checked & Approved By :
 Comment : Est Rev: M 04.12.02 Revised procedural steps KJ/JLM

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D206-642-241 CHG003

NA

2.0 D2620 Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description

1 D2620 Bent Tube 3" OD

Batch

B29388

150 7-2-1

3.0 D32861 Doubler



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-1 Doubler

B29090

4.0 D2647 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

1 D2647

Description Batch

Fwd Cap

B29328

BE 07-02-05

5.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

P/50 7-2-1

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:25:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 29179A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description:

2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod M102756/M101010 BE 07-02-05

4-Grind weld flush to cap on top surface only.

BE 07-02-05

5-Cut Aft end as per dwg 2650 from front of tube and Deburr

6-Remove inner indexing ridge on Aft end of skidtube as per Dwg D2650

7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025.

BE 07-02-06

8-Drill pilot holes using Dt 8167.

9-Locate DT8732 from inner Aft saddle hole & 3rd crossbolt hole. Insert D3286-1 doubler using DT8732 & D206-642-241-T1, then locating doubler off of 3/16" holes, cleco DT8732 & doubler leaving DT8732 for added support.

10- Drill D3286-1 doubler rivet holes in tube using # 40 drill, spot drilling doubler at the same time.

11-Working from the center out, drill # 30 holes into D3286-1 doubler. Cleco each hole as it is being drilled. Verify angle of holes to accommodate rivet heads.

BE 07-02-08

12-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650

13-Remove D3286-1 doublers, identify orientation, deburr, then attach them to the workorder

14-Remove indexing edge using DT8741 as per Dwg D2650

15-C'sink GHW rivet holes as per Dwg D2650

BE 07-02-09

6.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

2070.140

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:25:14 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 29179A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open crossbolt holes to Ø0.3125" as per Dwg D2650

Pm 07-02-14(1)

2-Drill pilot holes using DT8028-3, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6.

Pm 07-02-14(2)

3-Deburr tube and blow out chips from inside the tube

Pm 07-02-14(1)

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

Pm JD 7-2-14

9.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DP 7-2-17

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-3 Drilling Detail (without cutting fluid)

2-C'sink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr and blow out all chips from inside the tube

DP 7-2-17

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

BE 07-02-20

12.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total: 52.0000 Each(s)

Pick:

Qty Part Number Description Batch

52 CR3212-4-04 Rivet *M101334*

Pm 07-02-20(1)

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:25:14 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 29179A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

D26543

206 I-Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2654-3

Web

B 30724

JD 7-2-20

14.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required

2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up. Allow 12 Hrs. cure time before cutting

Start Date: 7-2-20 Time: 1:35

Finish Date: 07-02-21 Time: 3:30

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291

Sikaflex expire date:

M 102672
67-02-28

7-07-02-20
JD 7-2-20

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

BE 07-02-21

16.0

D2649

Crossbolt Spacer



Comment: Qty.: 18.0000 Each(s)/Unit Total: 18.0000 Each(s)

Pick:

Qty Part Number

Description Batch

18 D2649

Crossbolt spacer

B 20648

BE 07-02-21

17.0

D32863

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 D3286-3

Spacer

B 27401

BE 07-02-23

Dart Aerospace Ltd

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:25:14 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 29179A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 crossbolt spacers. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod M101050 BE 07-02-21

2-Grind welds flush as per Dwg D2650. Pm 07-02-22

3-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required.

A/RSS Rod NONE BE 07-02-23

4-Counterbore 5/16" x 0.750" deep except 7th hole from Aft end as per Dwg D2650. Deburr Pm 07-02-23

19.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivets M103525 Pm 07-02-23

20.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 M7885/3-4-3 Rivets M19099 Pm 07-02-23

21.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2680-041 Nut Plate B24203 Pm 07-02-23

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|--------------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:25:14 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 29179A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

22.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



hm 07-02-230



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

23.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

07/02/23 ①

24.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

07/02/23 ①

25.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3. Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs.

M103141

07-03-01 ①

26.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

07/03/02 ①

27.0

D26483

Wearpad



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

4 D2648-3

Wearpad

329777

28.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-13

Wearshoe

329009

07-03-02

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:25:14 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 29179A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

D265621

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-21

Wearshoe

B14364

30.0

D265633

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-33

Wearshoe

B29452

31.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D3429-1

Wearpad

B30237

32.0

ALS41032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total: 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 ALS4-1032-130 Inserts

M103496

or (see QSI 017)



33.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total: 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 AN960JD10L

Washer

M102832

all 07-03-02

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:25:15 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 29179A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

MS27039108

Screw



Comment: Qty.: 44.0000 Each(s)/Unit Total: 44.0000 Each(s)

Pick:

Qty Part Number Description Batch
44 MS27039-1-08 Screw M102630

35.0

D26511

Plug



Comment: Qty.: 18.0000 Each(s)/Unit Total: 18.0000 Each(s)

Pick:

Qty Part Number Description Batch
18 D2651-1 Plugs B329451

36.0

D26513

O-Ring



Comment: Qty.: 18.0000 Each(s)/Unit Total: 18.0000 Each(s)

Pick:

Qty Part Number Description Batch
18 D2651-3 O-Rings B29006

37.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 MS27039-4-06 Screw m6874

38.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 AN960JD416 Washer m103338

FL/

07/03/05

①

39.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1]

1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291 ~~m402672~~ m103497

FL

07/03/05

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:25:15 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 29179A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description:

Sikaflex expire date: 10/07

2-Install D2651-3 Q-Rings on D2651-1 plugs with Petroleum Jelly and install plugs as per Dwg D2650 (D2650-3 detail). Clean excess adhesive.

3-Install MS27039-4-06 Screw as per DEO 9153.

FL
07/03/05

①

40.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2646

Aft Cap

530119

41.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 MS27039-1-08 Screw

m102630

42.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 AN960JD10L

Washer

m102832

FL 07/03/05

①

43.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive

A/R Sikaflex-291

Sikaflex expire date:

m103497
10/07

) FL

07/03/05

①

2-Wing Walk as per Dwg D2650-3 and QSI 005 4.4

Batch:

m103480

SLP/

07-03-07

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| 0 | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

Date: Thursday, 10/26/2006 8:25:15 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 29179A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

44.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



20703-080



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

45.0

QC5

INSPECT WORK TO CURRENT STEP



20703-080



Comment: INSPECT WORK TO CURRENT STEP

46.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206664241 IF APPLICABLE

Location: _____

PPP Rev: _____

PPP

PU 7/3/14

B29178

47.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



U 070305

| W/O: | | WORK ORDER CHANGES | | | | | |
|------|------|--------------------|----|------|-----|-------------------------------------|--------------------------|
| DATE | STEP | PROCEDURE CHANGE | By | Date | Qty | Approval Chief Eng / Prod Mgr | Approval QC Inspector |
| | | | | | | | |
| | | | | | | | |

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

| NCR: | | WORK ORDER NON-CONFORMANCE (NCR) | | | | | | |
|------|------|----------------------------------|-----------------------------|---------------------------------|----------------|---------------------------|-----------------------|--------------------------|
| DATE | STEP | Description of NC Section A | Corrective Action Section B | | | Verification Section C | Approval Chief Eng | Approval QC Inspector |
| | | | Initial Chief Eng | Action Description Chief Eng | Sign & Date | | | |
| | | | | | | | | |
| | | | | | | | | |
| | | | | | | | | |

NOTE: Date & initial all entries

DART

| | | | |
|----------------------|----------------------|--|------------------------|
| DESIGN <i>UP</i> | DRAWN BY <i>P</i> | DART AEROSPACE USA, INC. PORT HADLOCK, WA | |
| CHECKED <i>PH</i> | APPROVED <i>H</i> | DRAWING NO. D2650 | REV. E SHEET 1 OF 5 |
| DATE 06.03.30 | | TITLE 206/407 SKIDTUBE ASSEMBLIES | SCALE NTS |
| A | 97.03.25 | NEW ISSUE | |
| B | 97.06.26 | AS MANUFACTURED CHANGES | |
| C | 97.10.29 | CHANGE HOLE PATTERN AND FRONT END | |
| D | 04.05.17 | REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3 | |
| E | 06.03.30 | RMV C'BORE, CHG DRILL, ADD CHAMFER | |

RELEASED
16 04 17 *H*

| Qty -1 | Qty -3 | Qty -5 | Qty -7 | Part Number | Description |
|-----------|-----------|-----------|-----------|---------------|---|
| X | | | | D2650-1 | SKIDTUBE ASSEMBLY |
| | X | | | D2650-3 | SKIDTUBE ASSEMBLY |
| | | X | | D2650-5 | SKIDTUBE ASSEMBLY |
| | | | X | D2650-7 | SKIDTUBE ASSEMBLY |
| 1 | 1 | 1 | 1 | D2600-1-160 | EXTRUSION |
| 1 | | | | D2654-1 | WEB |
| | 1 | | | D2654-3 | WEB |
| | | 1 | | D2654-5 | WEB |
| | | | 1 | D2654-7 | WEB |
| 1 | 1 | 1 | 1 | D2646 | AFT CAP |
| 1 | 1 | 1 | 1 | D2647 | CAP |
| 16 | 17 | 19 | 23 | D2649 | CROSS BOLT SPACER |
| 16 | 18 | 14 | 22 | D2651-1 | PLUG |
| 16 | 18 | 14 | 22 | D2651-3 | O-RING |
| 1 | 1 | 1 | 1 | D2680-041 | NUT PLATE |
| 2 | 2 | | | D3286-1 | DOUBLER |
| 2 | 2 | | | D3286-3 | STUD |
| 42 | 44 | 54 | 60 | ALS7-1032-130 | INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130) |
| 2 | 2 | 2 | 2 | AN960JD10L | WASHER |
| 2 | 2 | 2 | 2 | CCR264SS3-3 | RIVET |
| 2 | 2 | 2 | 2 | CR3212-4-03 | RIVET |
| 2 | 2 | 2 | 2 | MS27039-1-08 | SCREW |
| 1 | 1 | 1 | 1 | MS27039-4-06 | SCREW |
| 1 | 1 | 1 | 1 | AN960JD416 | WASHER |
| 52 | 52 | | | CR3212-4-04 | RIVET |


NOTES

- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED




SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 29179A

Copyright © 1997 by DART AEROSPACE USA, INC.



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

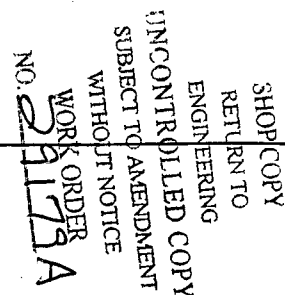

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 231779 A

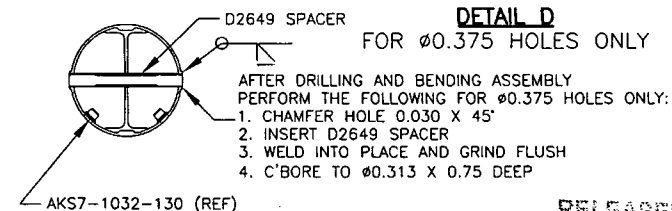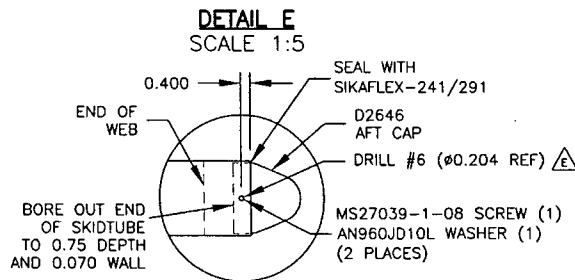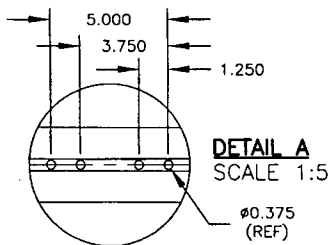


RELEASED

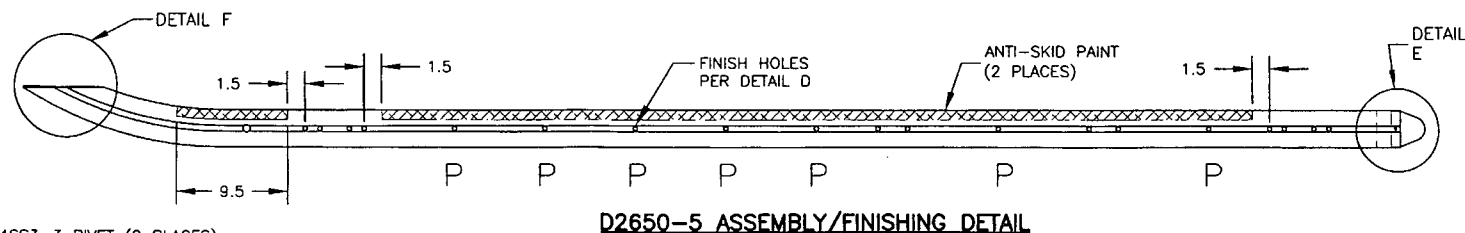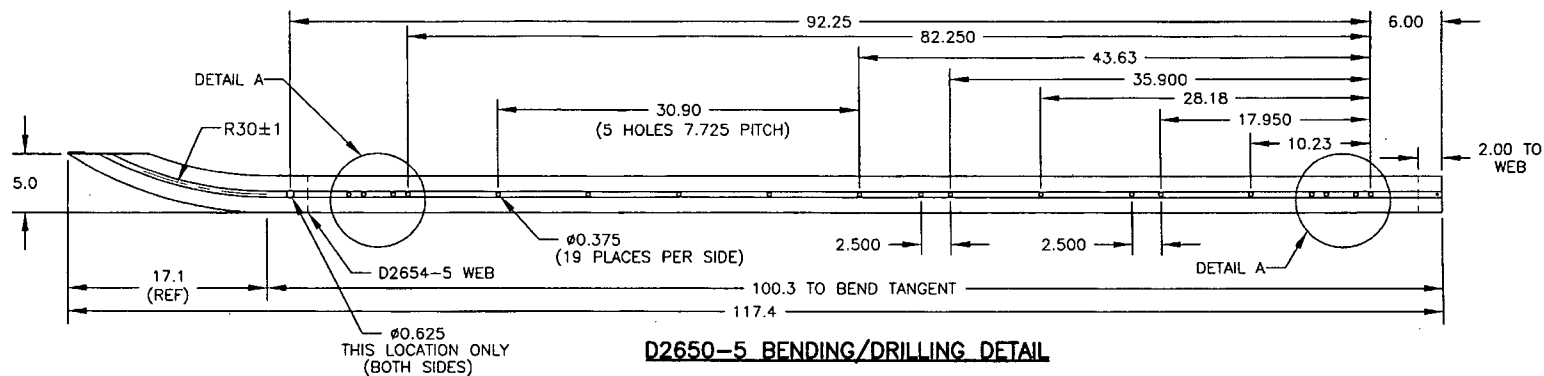

DETAIL F (NOT TO SCALE)

- CUT TUBE LEVEL
- REMOVE RIDGE ON FWD SIDE
- LOCATE D2647 (TRIM AS NECESSARY)
- WELD D2647 IN PLACE PER DART QSI 004
- GRIND FLUSH
- RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH









REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

- CCR264SS3-3 RIVET (2 PLACES)
- MS27039-4-06 SCREW (1)
- AN960JD416 WASHER (1)
- CR3212-4-03 RIVET (2 PLACES)
- D2680-041 NUTPLATE (1)
- D2647 CAP (1)

NO. 29179A
WORK ORDER
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
SHOP COPY
RETURN TO
ENGINEERING

| | | | | | |
|--|----------|----------|----------|--|--------------|
| COPYRIGHT © 2004 BY DART AEROSPACE USA, INC. | | DESIGN | DRAWN BY | DART DART AEROSPACE USA, INC. PORT HADLOCK, WA | |
| CHECKED | PH | APPROVED | | DRAWING NO. | REV. E |
| DATE | 06.03.30 | TITLE | SKIDTUBE | D2650 | SHEET 4 OF 5 |
| | | | | SCALE | 1:10 |

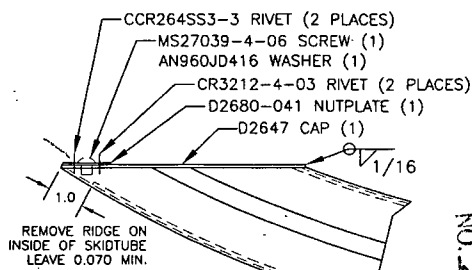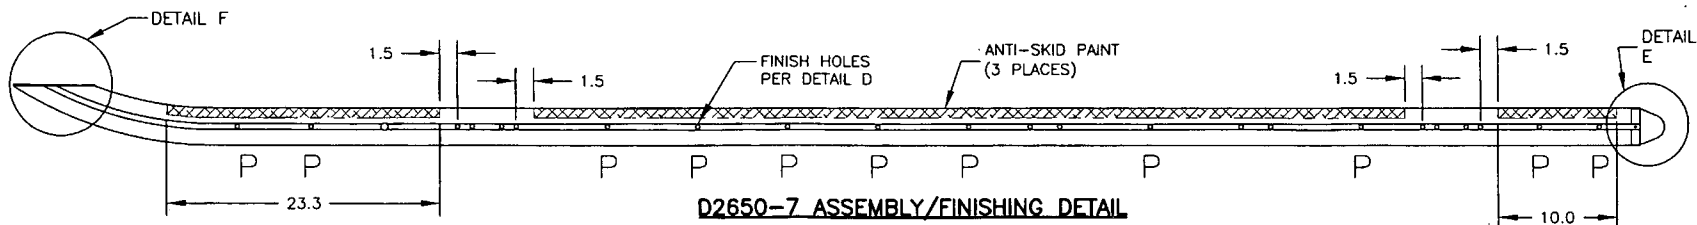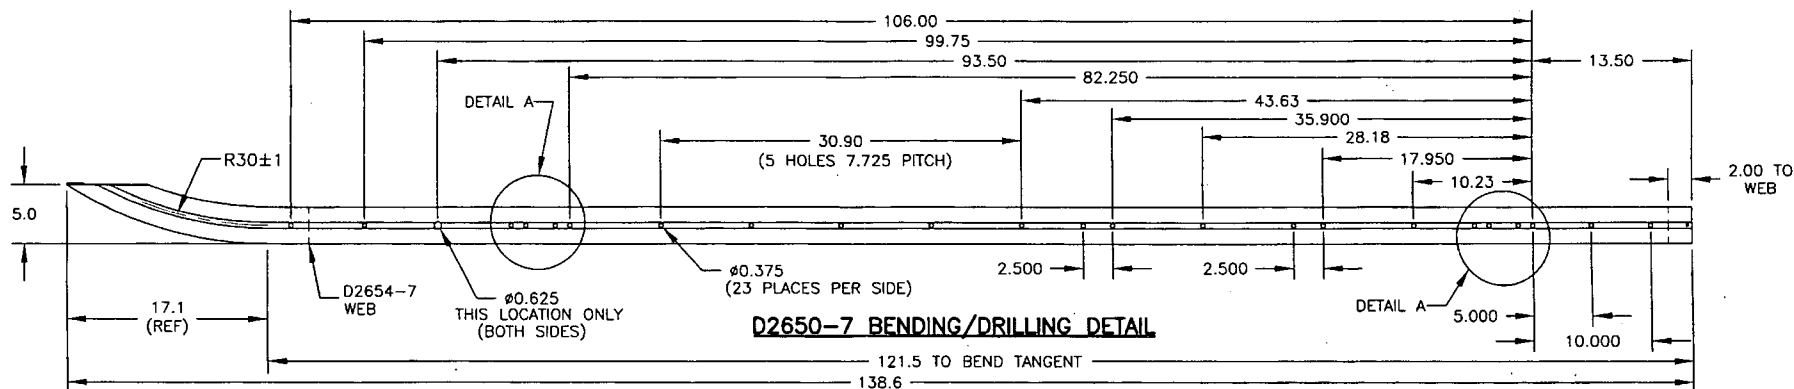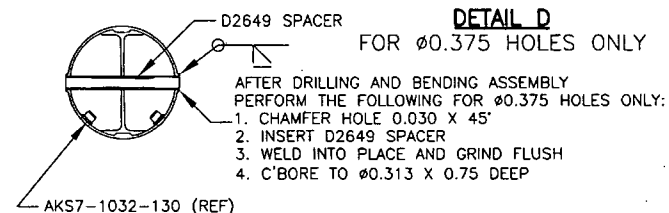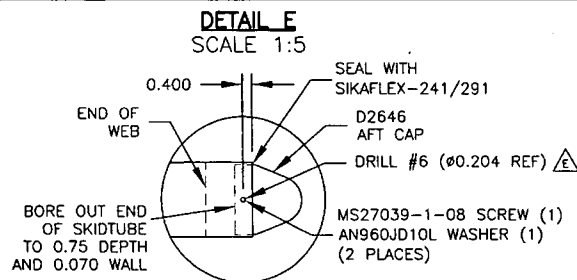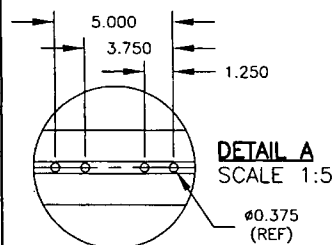

- DETAIL F (NOT TO SCALE)**
1. CUT TUBE LEVEL
 2. REMOVE RIDGE ON FWD SIDE
 3. LOCATE D2647 (TRIM AS NECESSARY)
 4. WELD D2647 IN PLACE PER DART QSI 004
 5. GRIND FLUSH
 6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MAKE THREADS IN D2680-041 PRIOR TO FINISH


NO. 29179A
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
CONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

| | | | | |
|---------|----------|----------|----------|--|
| DESIGN | UP | DRAWN BY | UP | DART DART AEROSPACE USA, INC. PORT HADLOCK, MA |
| CHECKED | PH | APPROVED | PH | DRAWING NO. D2650 |
| DATE | 06.03.30 | TITLE | SKIDTUBE | REV. E SHEET 5 OF 5 SCALE 1:10 |

RELEASED
0.04.17

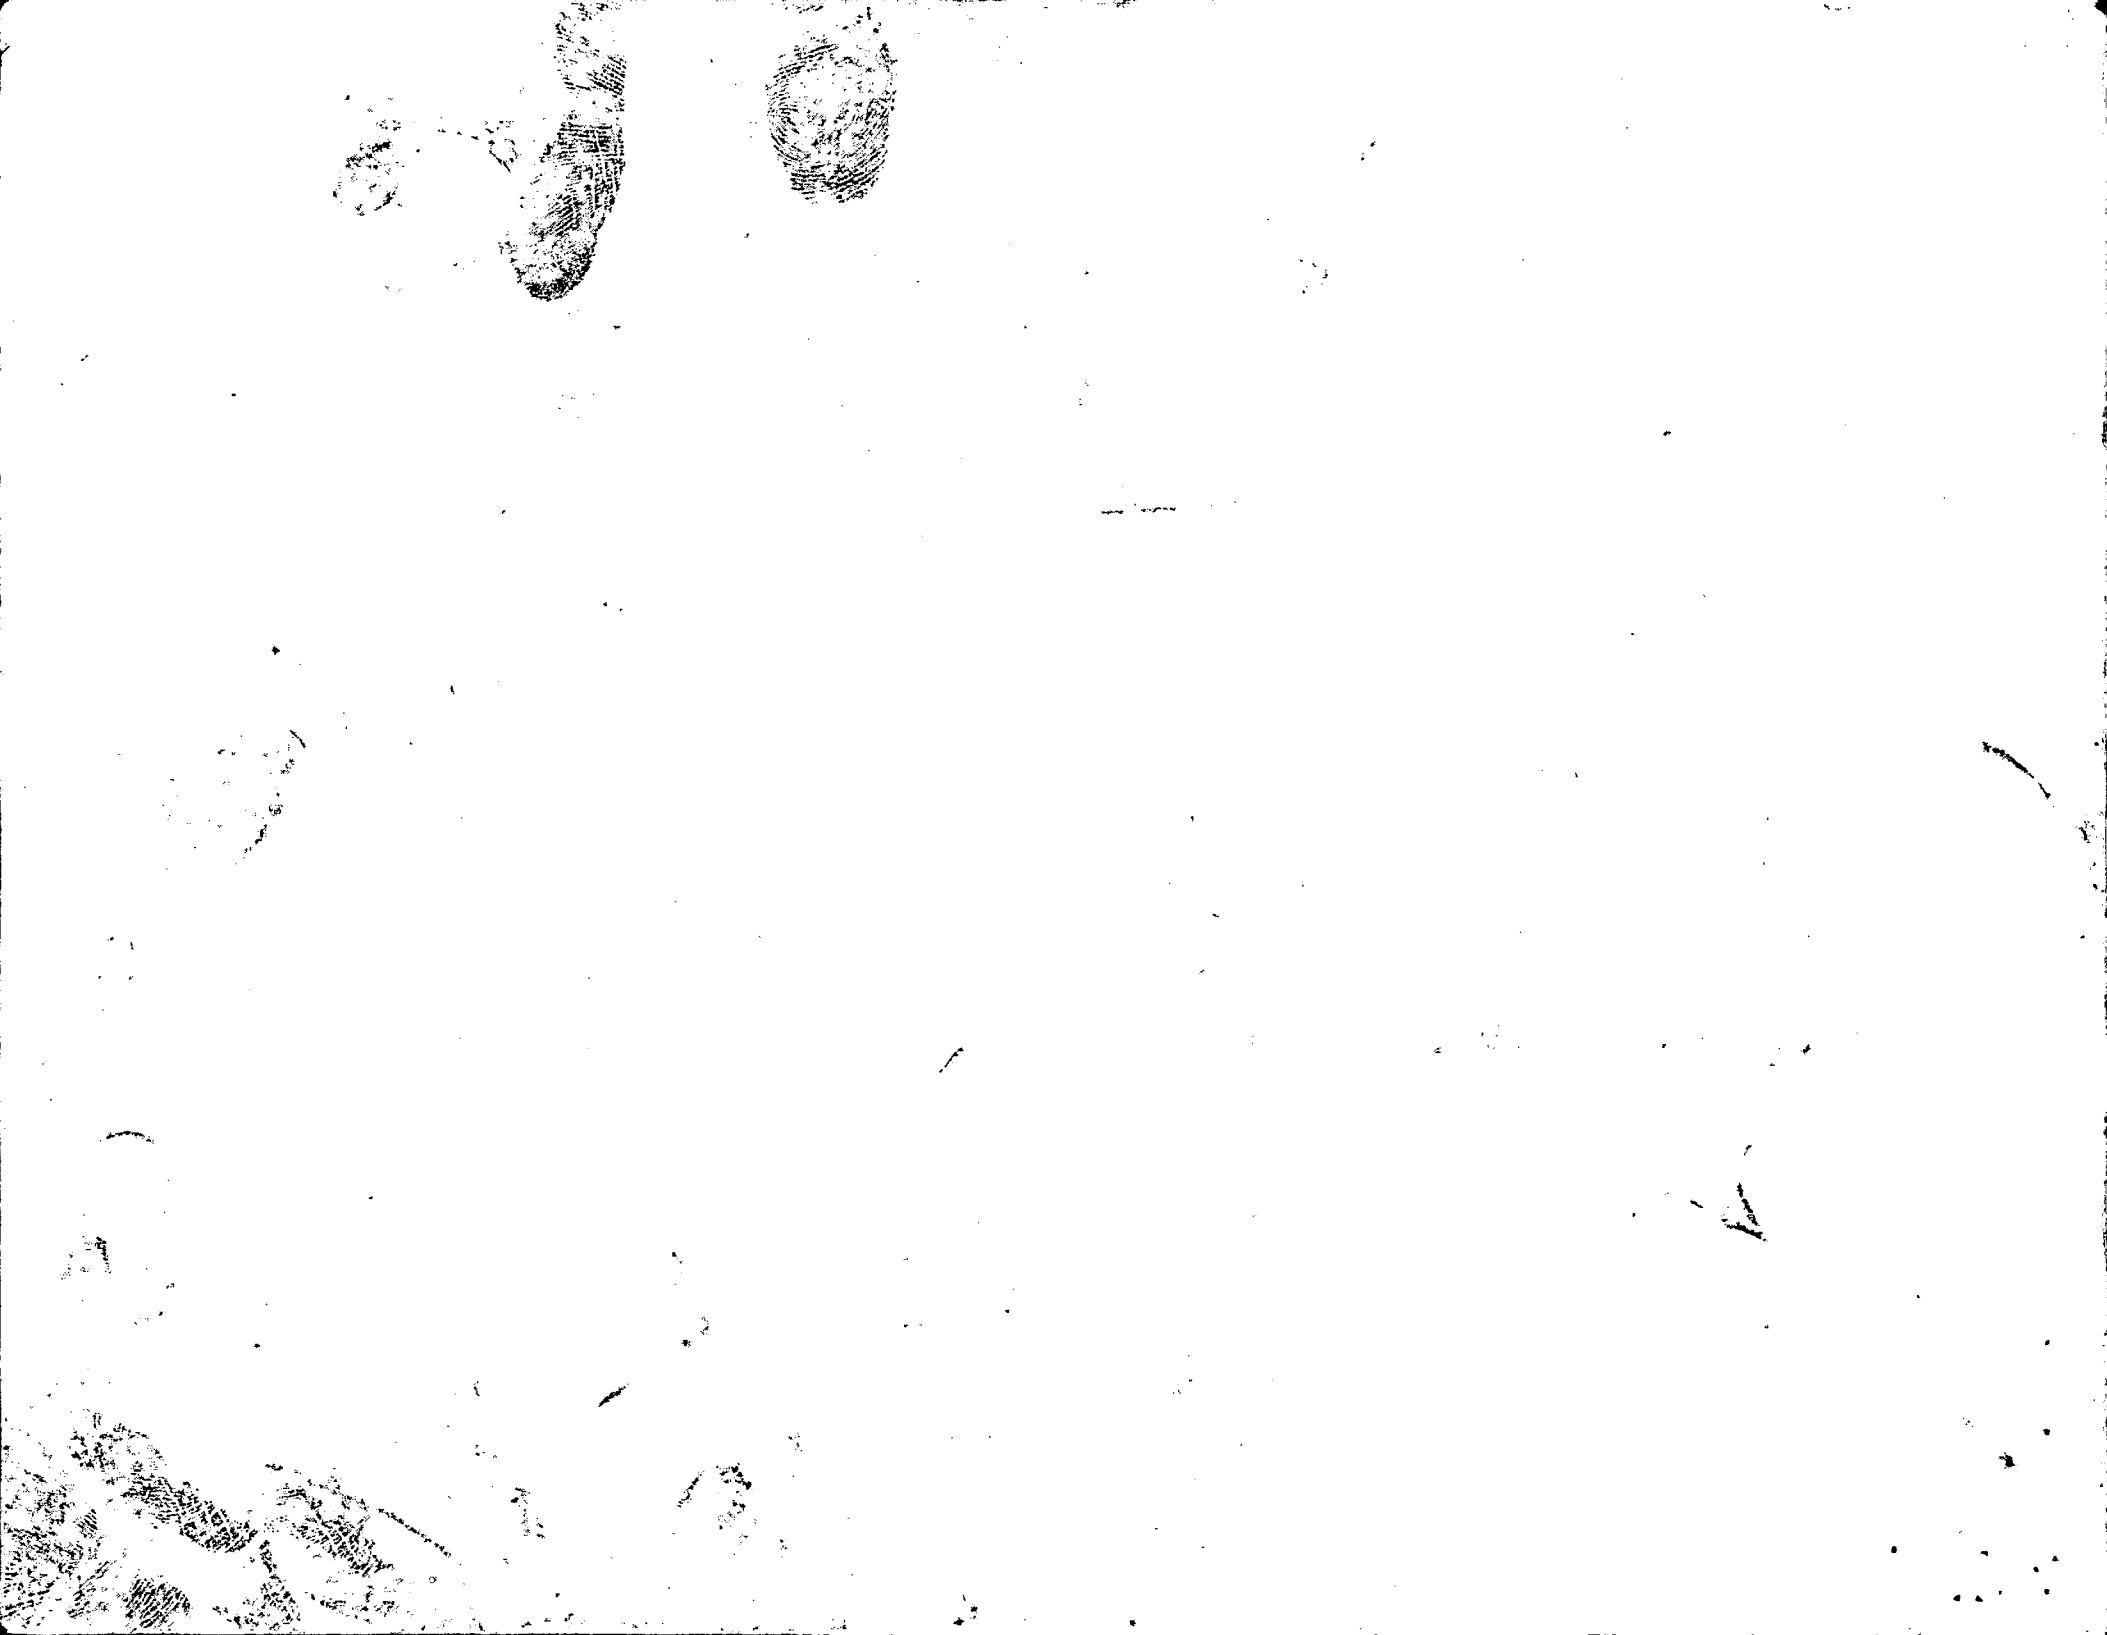

Jason Murdoch

From: Bill Beckett [bbeckett@dartaero.com]
Sent: Monday, February 05, 2007 1:10 PM
To: 'Jason Murdoch'
Cc: 'L Lacelle'
Subject: RE: sikaflex-291

Jason,
Yes.
Bill

From: Jason Murdoch [mailto:jmurdoch@dartaero.com]
Sent: February 5, 2007 12:49 PM
To: 'Bill Beckett'
Subject: sikaflex-291

Bill,
We have 25 tubes of sikaflex-291, batch M102672, that expires at 02/2007. Is it acceptable to use the remainder until the end of this month?

jmurdoch@dartaero.com
Q.C. COORDINATOR

NO. 95

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure 119
Part number and Job number 206642 441 / B 30266

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS TIG
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

| | Position | Vertical | Down <input type="checkbox"/> | Up <input type="checkbox"/> |
|--------------|-----------------------------|-----------------------------|-------------------------------|-----------------------------|
| Sheet Groove | 1G <input type="checkbox"/> | 2G <input type="checkbox"/> | 3G <input type="checkbox"/> | 4G <input type="checkbox"/> |
| Tube Groove | 1G <input type="checkbox"/> | 2G <input type="checkbox"/> | 5G <input type="checkbox"/> | 6G <input type="checkbox"/> |
| Sheet Fillet | 1F <input type="checkbox"/> | 2F <input type="checkbox"/> | 3F <input type="checkbox"/> | 4F <input type="checkbox"/> |
| Tube Fillet | 1F <input type="checkbox"/> | 2F <input type="checkbox"/> | 4F <input type="checkbox"/> | 5F <input type="checkbox"/> |

Crossbolt Spacer Welded into N/A Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07/02/22 Qualifier David S. S. S.